


Installing the Xitron Navigator RIP for iCtP PlateWriters

Installing a new RIP for an iCtP PlateWriter on a clean Windows PC will in most cases require the Microsoft Visual C++ 2008 Redistributable Package (x86) to be installed. The install of this package must be done before installing a new RIP and plug-in software. The PlateWriter plug-in software requires this package along with the Visual C++ 2012 Redistributable Package. The 2012 package is already included in the plug-in software install package.

Further when installing a new version 10 RIP and plug-in you must choose to install a 32 bit RIP version, even on a 64 bit Windows version. The plug.in will not support a 64 bit RIP version.

Please use the link below to download and install Visual C++ 2008 Redistributable Package (x86)

https://www.microsoft.com/en-us/download/details.aspx?id=29

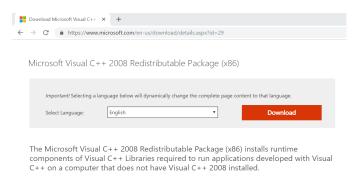

The latest installer disc both include Xitron Navigator version 8 and 10. This installer disc does not include the Visual C++ 2008 Redistributable Package (x86) package. You can download it from here.

10088133 - INSTALLATION, DISK, PW

Please note if the RIP and iCtP PlateWriter plug-in already is installed before adding the Visual C++ 2008 Redistributable Package (x86) package. Likely the error message below will be displayed when launching the RIP.



Then install the Visual C++ 2008 Redistributable Package (x86) package followed by reinstalling the iCtP PlateWriter plug-in. Choose to repair the current Visual C++ 2012 Redistributable package when prompted at the plug-in install.